
Service Information Page 1 of 3



Document ID# 1507485 2005 Chevrolet Corvette



Headlamp, Fog Lamp, Turn Signal Lamp, Side Marker Lamp Replacement - Front

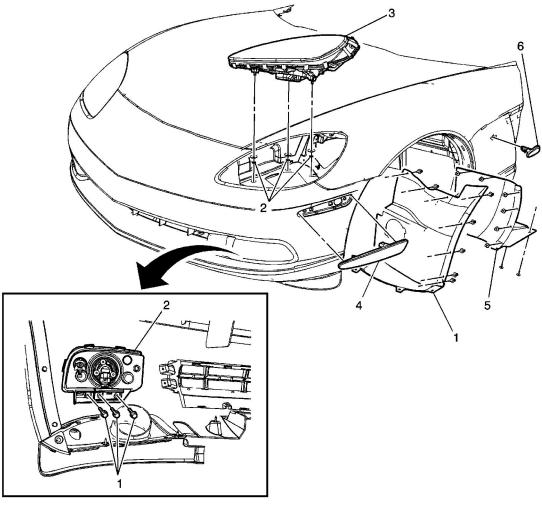



Callout

Component Name

Notice

Refer to Fastener Notice in Cautions and Notices.

Fastener Tightening Specifications: Refer to Fastener Tightening Specifications.

Service Information Page 2 of 3

Headlamp	Lamp Assembly Replacement
	Liner, Wheelhouse Front
1	Refer to Fender, Insulator, Liner, Brake Caliper Cooling Duct Replacement - Front in Body Front End.
2	Nuts, Headlight Assembly (Qty:3)
	Tighten 6 N⋅m (53 lb in)
3	Headlamp Assembly
	Caution
	Refer to Halogen Bulb Caution in Cautions and Notices.
	Tip Disconnect the electrical connector.
	Tip Aim lamp as necessary.
	Tip The front wheelhouse liner has an access door for bulb replacement.
Front Side	e Marker Lamp Replacement
	ne front wheelhouse liner to gain access to the front side marker lamp. Refer to Fender, Liner, Brake Caliper Cooling Duct Replacement - Front in Bumpers.
4	Lamp Assembly, Front Side Marker
	Tip
	Release the tab from the inside of the fascia and push outward to replace the lamp assembly.
	Twist the bulb socket and pull inward to replace the bulb.
Repeater .	Lamp Replacement (Export)
	ne rear wheelhouse liner to gain access to the repeater lamp. Refer to Fender, Insulator, ke Caliper Cooling Duct Replacement - Front in Bumpers.
5	Liner, Whellhouse Rear
6	Lamp, Repeater Lamp
	Tip
	Release the tab from the inside of the fascia and push outward to replace the lamp assembly.
	Twist the bulb socket and pull inward to replace the bulb.
	Fog Lamp Assembly Replacement
1	Bolts, Fog Lamp (Qty:3)
	Tighten 2 N·m (18 lb in)

Service Information Page 3 of 3

	Lamp Assembly, Front Turn Signal
	Caution
2	Refer to Halogen Bulb Caution in Cautions and Notices.
	Tip Twist the bulb socket and pull inward to replace the bulb.
	Tip Aim as necessary.



Document ID# 1507485 2005 Chevrolet Corvette

